




RETAINING WALL SCHEDULE											
Н	BASE	В	Α	С	D	"L" BARS	"M" BARS	″□″ BARS	"P" BARS	"Q" BARS	"R" BARS
2' TO 3'	2'-3"	0′-6″	0′-8″	1'-1"	5 #4	#4@12"	#4@12*	#4@12"	#5 @ 12 *	-	-
3'-1 ' TO	4′-5 ″	0'-9"	0'-8"	3′-0″	5 #5	#4@12*	#4 @ 10 *	#4@10"	#5 @ 12 "	1	1

RETAINING WALL DETAIL

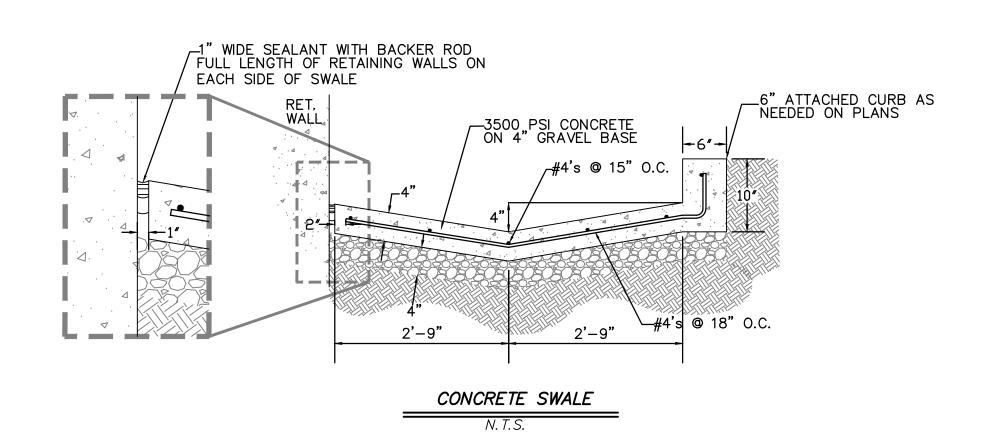

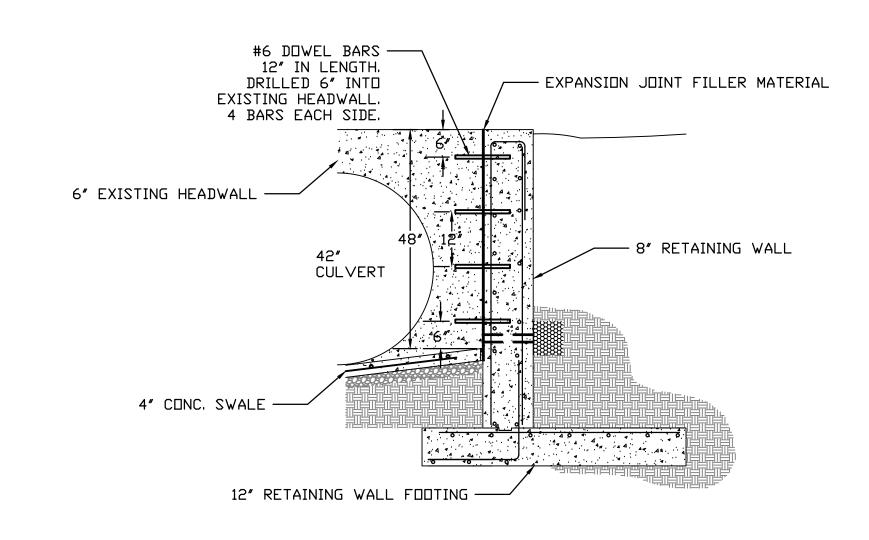

HEADWALL TIE-IN DETAIL

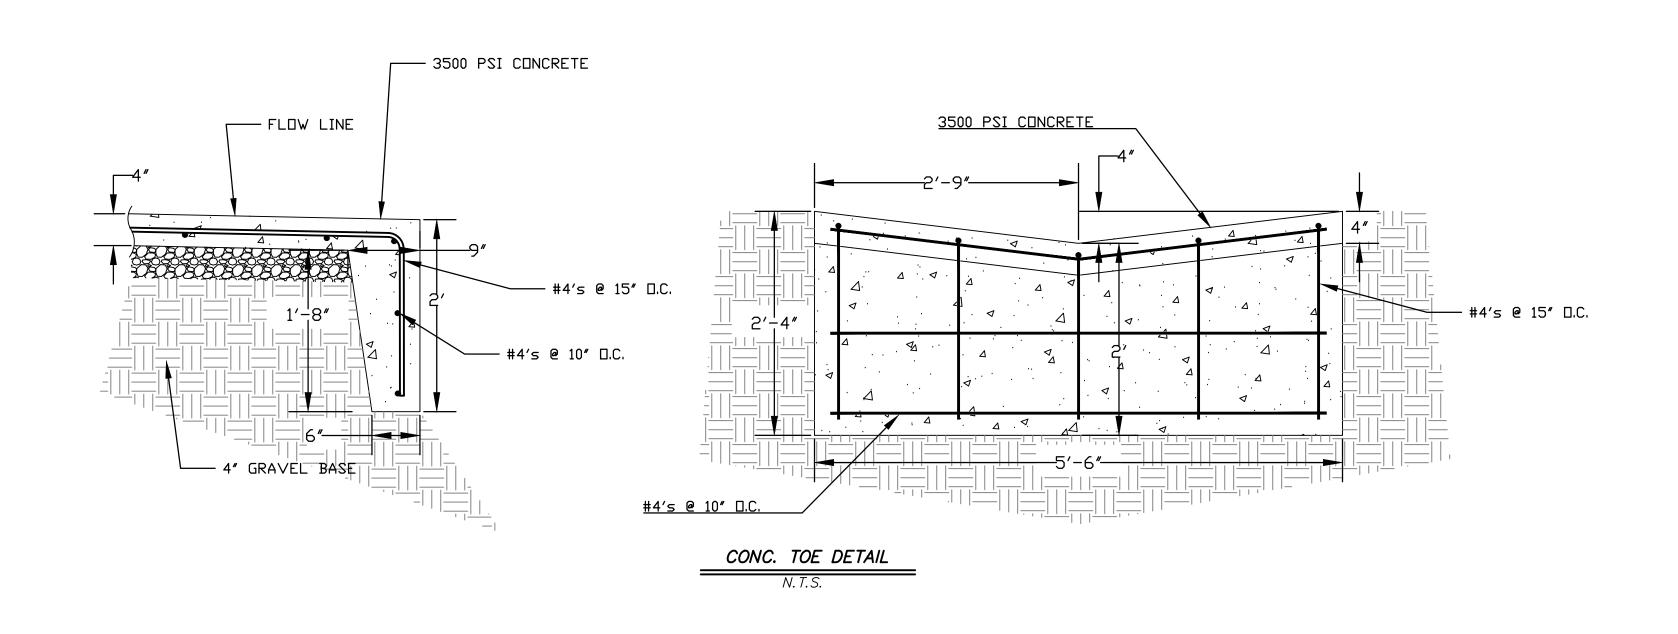

Vitarianamum	REVISIONS ITEM DESCRIPTION OF CHANGE A		TBM: Northwest corner of 6-72 inlet, iron cover located 29.2' south of a power pole. Elevation = 364.46 THIS PROPERTY IS NOT LOCATED IN A SPECIAL FLOOD HAZARD AREA PER F.E.M.A. FLOOD INSURANCE RATE MAP NO. 47157C0330G, ZONE X, EFFECTIVE DATE FEBRUARY 6, 2013.	DEPARTMENT OF ENGINEERING WALL & SWALE DETAILS LAKELAND, TENNESSEE FROM: _NA TO: _NA SURVEY:MLS DATE: 07/16_ BOOK: _DC		
	NO. DESCRIPTION OF CHANGE APPROVED DATE	DATE	GREEN SPRUCE BEND DITCH IMPROVEMENTS			
OF TENSOR			RENAISSANCE GROUP, INC. 9700 VILLAGE CIRCLE, SUITE 100 LAKELAND, TN 38002 (901) 332-5533 VOICE (901) 332-5534 FAX EMAIL @RGROUP.BIZ	SCALE:1"=5' DESIGN: _JWW_DATE: 8/16 CKD: _JWW_DATE: _8/16 REVIEWED BY: TOWN ENGINEERDATE		