Board of County Commissioners

Okeechobee County



1700 NW 9th Avenue, Ste C Okeechobee, Florida 34972 863-763-0805 Fax 863-763-5529

ADDENDUM NO. 1

Project Name: Okeechobee County Project No. 2017-11

Demolition, Removal & Disposal Services of the ARC Building located at 403 NW 2nd Avenue

Date: June 12, 2017

This addendum forms part of the contract documents dated May 19, 2017, for the subject project as prepared by Okeechobee County. Please acknowledge receipt of the addendum in the Bid Proposal Form.

ADDITIONS, MODIFICATIONS AND/OR CLARIFICATIONS TO THE PLANS AND SPECIFICATIONS

I. <u>INSTRUCTIONS:</u>

- 1. This Addendum shall be included as part of the original Contract Documents and the work required therein.
- 2. All work performed under this addendum shall be subject to the requirements of the Specifications and the Drawings for the work of this Project.
- 3. Submit written acknowledgement of receipt, understanding, and incorporation of all items of this addendum into the bid price along with the bid. <u>Bids submitted without this written acknowledgement statement will be considered incomplete and disqualified.</u>

Addendum No. 1 Page 1 of 3

II: ATTACHMENTS, AMENDMENTS AND/OR CLARIFICATIONS:

1. Revise the bid opening date from June 14, 2017 to June 21, 2017

SEALED BIDS for Okeechobee County ITB # 2017-11, described as <u>Demolition, Removal & Disposal</u>
<u>Services of the ARC Building located at 403 N.W. 2nd Avenue, Okeechobee, Florida for Okeechobee County</u> will be received by the Board of County Commissioners of Okeechobee County, Florida, Historic Courthouse, 304 NW 2nd Street, Room 123, Okeechobee, Florida 34972 <u>until 3:00</u> <u>p.m. local time, on June 21, 2017.</u> Any bids received after the date and time specified will not be considered.

- 2. Additional Information the Okeechobee County Fire & Rescue Department in conjunction with Okeechobee City Fire Department has chosen the ARC Building for fire training. All Contractors shall be aware that some or all, of the combustible material in the ARC Building will be incinerated during the training session. All Contractors shall take this into consideration prior to submitting their bids.
- **3.** The Invitation to Bid, second paragraph is hereby amended to read"A demolition permit issued by the <u>City of Okeechobee Building Department</u> shall be required before work commences."
- 4. Pre-Bid Requests for Information:

Question: Does your local vendor preference apply to companies based in Indian River County.

Answer: No, go to this site to see our current Local vendor preference policy:

http://www.co.okeechobee.fl.us/government/county-procurement-policy

Question: Has an asbestos and lead paint test been completed and if so what are the results? **Answer:** An asbestos survey was performed and will be provided (see attached report).

Question: Are the demolished materials the property of the contractor?

Answer: Removal of <u>All</u> material related to the demolition is the responsibility of the Demolition Contractor and shall be removed from the site and disposed of as indicated in the Contract Documents. Concrete and metal may be recycled if it is recycled in a proper manner.

Question: Will all utilities be safe offed by the county prior to commencement of demolition?

Answer: All utilities will be shutoff prior to the demolition by the Owner.

Question: Are any materials or equipment onsite not to be demolished? If so who is responsible for the removal and storing?

Answer: See Scope of Work provided in the Contract Documents. The Owner will be removing the A/C Units and kitchen cabinets.

Question: If a safety fence is required what are the boundaries of the fenced area?

Answer: No safety fence is required. However, it is up to the Contractor to maintain a safe working environment.

Addendum No. 1 Page 2 of 3

Question: Are the existing asphalt surfaces to be demolished?

Answer: Yes, remove the asphalt only.

Question: What are the final grade requirements?

Answer: Fill any depression with clean compactable fill material and match the existing surrounding

ground elevation.

5. Attachments:

Demolition Asbestos Survey Report

END OF ADDENDUM NO. 1

This document must be signed by the bidder's authorized representative and permanently attached to the Bidder's Proposal (i.e. stapled) in its entirety. Proposal submitted without Addendum and unsigned will be incomplete and will not be accepted.

| Name of Bidder: | | Date: | |
|-----------------|-----------------------|--------|--|
| By | | Title: | |
| • | (signature of bidder) | | |

Addendum No. 1 Page 3 of 3

DEMOLITION ASBESTOS SURVEY REPORT

ARC Building 403 Northwest 2nd Avenue Okeechobee, Florida

GLE Project No.: 17000-17833

Prepared for:

Okeechobee County Facilities Maintenance 464 Highway 98 North Okeechobee, Florida 34972

May 2017

Prepared by:





May 25, 2017

Mr. Donnie Oden Okeechobee County Facilities Maintenance 464 Highway 98 North Okeechobee, Florida 34972

RE: Demolition Asbestos Survey Report ARC Building 403 Northwest 2nd Avenue Okeechobee, Florida

GLE Project No.: 17000-17833

Dear Mr. Oden:

GLE Associates, Inc. (GLE) performed a demolition survey for asbestos-containing materials (ACM) on May 17, 2017, at the ARC Building, located in Okeechobee, Florida. The survey was performed by Mr. Brandon Christensen with GLE. This report outlines the sampling and testing procedures, and presents the results along with our conclusions and recommendations.

GLE appreciates the opportunity to serve as your consultant on this project. If you should have any questions, or if we can be of further service, please do not hesitate to call.

Sincerely,

GLE Associates, Inc.

Brandon Christensen

Environmental Scientist

Robert B. Greene, PE, PG, CIH, LEED AP

President

Asbestos Consultant, EA 0000009

BSC/PSZ/RBG/el

H:\Work\ASB\17000\17833 Okeechobee - ARC Building ACM Pre-Demolition Survey\Report\ARC Building SurveyReport.doc

GLE Associates, Inc.

TABLE OF CONTENTS

| 1.0 | INT | RODUCTION | 1 |
|------|-------|--|---|
| | 1.1 | Introduction | 1 |
| | | Facility Description | |
| 2.0 | RES | ULTS | 1 |
| | 2.1 | Asbestos Survey Procedures | 1 |
| | 2.2 | Asbestos Survey Procedures Identified Suspect Asbestos-Containing Materials | 2 |
| | | Table 2.2-1 — Summary of Homogeneous Sampling Areas | |
| 3.0 | CON | NCLUSIONS AND RECOMMENDATIONS | 4 |
| | 3.1 | General | 4 |
| 4.0 | LIM | ITATIONS AND CONDITIONS | 4 |
| APP] | ENDIC | CES | |
| | Appe | endix A – Analytical Results and Chain of Custody | |
| | Appe | endix B – Personnel and Laboratory Certifications | |

1.0 INTRODUCTION

1.1 INTRODUCTION

The purpose of this demolition survey was to identify accessible asbestos-containing materials (ACMs) and their general locations within the ARC Building, located at 403 Northwest 2nd Avenue in Okeechobee, Florida. The survey was conducted pursuant to National Emission Standards for Hazardous Air Pollutants (NESHAP, 40 CFR 61) requirements, associated with the scheduled demolition plans. The survey was performed on May 17, 2017, by Mr. Brandon Christensen and Mr. Derek Rodriguez, Environmental Protection Agency/Asbestos Hazard Emergency Response Act (EPA/AHERA) accredited inspectors. The scope of this survey did not include demolition of any building components, evaluation of architectural plans, or the quantification of materials for abatement purposes, or removal cost estimating.

1.2 FACILITY DESCRIPTION

A summary of the facility investigated is outlined in the table below.

| Facility Type: | Commercial |
|--------------------|---|
| Construction Date: | 1940 - 1980 |
| Number of Floors: | 1 |
| Exterior | |
| Floor Support: | Concrete Slab on Grade |
| Wall Support: | Concrete Masonry Units |
| Exterior Finish: | Paint, Stucco |
| Roof System Type: | Asphalt Sheet (Rolled Roofing), Metal Panel |
| Interior | |
| Wall Substrate: | Drywall and Joint Compound, Plaster |
| Wall Finishes: | Paint, Texture |
| Floor Finishes: | Ceramic Tile |
| Ceiling System: | Suspended Ceiling System |
| Ceiling Finishes: | Suspended Ceiling Tiles |

2.0 RESULTS

2.1 ASBESTOS SURVEY PROCEDURES

The survey was performed by visually observing accessible areas of the building. An EPA/AHERA accredited inspectors performed the visual observations (refer to Appendix B for personnel qualifications).

After the overall visual survey was completed, representative sampling areas were determined. The surveyors delineated homogeneous areas of suspect materials and samples of each material

were obtained, in general accordance with regulations as established by the Occupational Safety and Health Administration (OSHA) and NESHAP. The field surveyors determined sample locations based on previous experience. Both friable and non-friable materials were sampled. A friable material is one that can be crushed when dry by normal hand pressure. This survey did not include the demolition of building components to access suspect material.

After completion of the fieldwork, the samples were delivered to GLE's National Voluntary Laboratory Accreditation Program (NVLAP) accredited laboratory for analysis. The samples were analyzed by Polarized Light Microscopy (PLM) coupled with dispersion staining, in general accordance with EPA-600/R-93/116. Utilizing this procedure, the various asbestos minerals (chrysotile, amosite, crocidolite, actinolite, tremolite, and anthophyllite) can be determined. The percentages of asbestos minerals in the samples were visually determined by the microscopist. Please note that the EPA designates all materials containing greater than 1% asbestos as an "asbestos-containing material" (ACM).

Regulated Asbestos-Containing Material (RACM) is defined as (a) Friable asbestos materials, (b) Category I non-friable ACM that has become friable, (c) Category I non-friable ACM that will be or has been subjected to sanding, grinding, cutting, or abrading, or (d) Category II non-friable ACM that has a high probability of becoming or has become crumbled, pulverized, or reduced to powder by the forces expected to act on the material in the course of demolition or renovation operations regulated by this subpart.

Category I and Category II non-friable ACM, as defined by the EPA:

- Category I non-friable ACM means asbestos-containing packings, gaskets, resilient floor covering, asphalt roofing products, and pliable sealants and mastics that are in good condition and not friable, containing more than 1 percent asbestos, as determined using the method specified in Appendix E, Subpart E, 40 CFR Part 763, Section 1, PLM.
- Category II non-friable ACM means any material, excluding Category I non-friable ACM, containing more than 1 percent asbestos as determined using the methods specified in Appendix E, Subpart E, 40 CFR Part 763 Section 1, PLM that, when dry, cannot be crumbled, pulverized, or reduced to powder by hand pressure.

2.2 IDENTIFIED SUSPECT ASBESTOS-CONTAINING MATERIALS

A total of 57 samples of suspect building materials were collected from the facility during the survey, representing 19 different identified homogeneous areas. The results of the laboratory analyses are included in Appendix A.

A summary of the homogenous sampling areas of suspect ACM determined to be present is outlined in the following table:

| | TABLE 2.2-1: SUMMARY OF HOMOGENEOUS SAMPLING AREAS ARC BUILDING – OKEECHOBEE, FLORIDA | | | | | | | |
|--------|--|----------------------|----|----|-----|-----|----|--|
| HA # | HA # HOMOGENEOUS MATERIAL DESCRIPTION HOMOGENEOUS MATERIAL LOCATION FRIABILITY (F/NF) % ASBESTOS* # OF SAMPLES COLLECTED | | | | | | | |
| CT-01 | White 2'x4' Ceiling Tile | Throughout | F | ND | 3 | NIS | NA | |
| DW-01 | Drywall w/Joint Compound | Throughout | NF | ND | 3 | NIS | NA | |
| M-01 | Gray Sink Undercoat | Kitchen | NF | ND | 3 | NIS | NA | |
| M-02 | Yellow Carpet Glue | South Office | NF | ND | 3 | NIS | NA | |
| M-03 | Black Felt Paper under Metal Roof | Roof | NF | ND | 3 | NIS | NA | |
| M-04 | Brown and White Ceramic Tile Grout | Restrooms | NF | ND | 3 | NIS | NA | |
| M-05 | Gray Floor Leveling w/White Backside Under Ceramic Tile in Main Area and North/West Areas | | ND | 3 | NIS | NA | | |
| M-06 | Concrete Building Slab | Building Foundation | NF | ND | 3 | NIS | NA | |
| M-07 | 7 Gray Window Glazing Northwest Storage Area from Exterior | | NF | ND | 3 | NIS | NA | |
| M-08 | White Calking at Kitchen Counter | Kitchen | NF | ND | 3 | NIS | NA | |
| MAS-01 | White HVAC Mastic | Above Ceiling | NF | ND | 3 | NIS | NA | |
| MAS-02 | Gray HVAC Mastic | Northeast A/C Closet | NF | ND | 3 | NIS | NA | |
| PCT-01 | White Popcorn Treatment | North Side Interior | F | ND | 3 | NIS | NA | |
| PL-01 | Interior Plaster Wall | Throughout | NF | ND | 3 | NIS | NA | |
| PL-02 | Exterior Stucco | Exterior | NF | ND | 3 | NIS | NA | |
| R-01 | Black Rolled Roof | Center Roof Section | NF | ND | 3 | NIS | NA | |
| RF-01 | Black Roof Flashing at Metal Roof | Roof | NF | ND | 3 | NIS | NA | |
| RF-02 | Black Roof Flashing | Roof | NF | ND | 3 | NIS | NA | |
| S-01 | Yellow Texture over Drywall | Throughout | NF | ND | 3 | NIS | NA | |

| ASBESTOS CONTENT Expressed as percent | *= The facility owner has the option of point-counting by polarized light microscopy (PLM) those RACM whose asbestos content is less than 10% in order to more accurately determine the asbestos content therein. PC = Results based on Point-Count analysis | | | | | | |
|---------------------------------------|---|---|---|------------------|---|---------|-----------|
| FRIABILITY | F = Friable Material | NF = Non-Friable Materia | l | | | | |
| ACM CATEGORY | RACM = Regulated ACM | CAT I = Category I non-friable ACM | | | | | |
| ABBREVIATIONS: | NA = Not Applicable | ND = None Detected $NIS = Not in Scope$ $C = Chrysotile$ $A = Amos$ | | A = Amosite | | | |
| | HA = Homogeneous Area | SF = Square Feet | | LF = Linear Feet | ţ | CF = Cu | ıbic Feet |

3.0 CONCLUSIONS AND RECOMMENDATIONS

3.1 GENERAL

No asbestos-containing materials were identified in the scope of this survey.

4.0 LIMITATIONS AND CONDITIONS

As a result of previous renovations, there may be hidden materials, such as floor tile, sheet vinyl flooring, insulation, etc. These materials may be found in various areas hidden under existing flooring materials or in wall cavities. Any materials found during construction activities, either not addressed in this survey report, or similar to the ACM identified in this survey report should be assumed to be ACM until sampling and analysis documents otherwise.

Because of the hidden nature of many building components (i.e. within mechanical chases), it may be impossible to determine if all of the suspect building materials have been located and subsequently tested. Destructive testing in some instances is not a viable option. We cannot, therefore, guarantee that all potential ACM has been located. For the same reasons, estimates of quantities and/or conditions are subject to readily apparent situations, and our findings reflect this condition. We do warrant, however, that the investigations and methodology reflect our best efforts based upon the prevailing standard of care in the environmental industry.

The information contained in this report was prepared based upon specific parameters and regulations in force at the time of this report. The information herein is only for the specific use of the client and GLE. GLE accepts no responsibility for the use, interpretation, or reliance by other parties on the information contained herein, unless prior written authorization has been obtained from GLE.

APPENDIX A Analytical Results and Chain of Custody

Okeechobee County Facilities; Arc Building

17000-17833

| Sample | Sample Type | | Fiber Type |
|-----------|--------------------------------------|------------|--|
| CT-01A | 2x4 White Ceiling Tile | 70% 30% | Mineral Wool Perlite, Quartz, Calcite |
| CT-01B | 2x4 White Ceiling Tile | 70% 30% | Mineral Wool Perlite, Quartz, Calcite |
| CT-01C-QC | 2x4 White Ceiling Tile | 70% 30% | Mineral Wool Perlite, Quartz, Calcite |
| DW-01A | Drywall & Joint Compound | 100% | Gypsum, Quartz, Calcite, Clay |
| DW-01B | Drywall & Joint Compound | 100% | Gypsum, Quartz, Calcite, Clay |
| DW-01C | Drywall & Joint Compound | 100% | Gypsum, Quartz, Calcite, Clay |
| M-01A | Gray Sink Undercoat | 100% | Polymer, Quartz, Calcite, Clay, Mica |
| M-01B | Gray Sink Undercoat | 100% | Polymer, Quartz, Calcite, Clay, Mica |
| M-01C | Gray Sink Undercoat | 100% | Polymer, Quartz, Calcite, Clay, Mica |
| M-02A | Yellow Carpet Glue | 100% | Polymer |
| M-02B | Yellow Carpet Glue | 100% | Polymer |
| M-02C | Yellow Carpet Glue | 100% | Polymer |
| M-03A-QC | Black Felt Paper Under Metal Roof | 100% | Cellulose/paper |

Analyst / Approved Signatory:

Darryl Neldner

Analysis performed by GLE Associates, Inc. NVLAP Code 102003-0, CO AL-17485, TX 30-0337

Feedback regarding laboratory performance should be addressed to lab@gleassociates.com.

Report Date: 5/18/2017 Page 1 of 5

^{*} Polarized Light Microscopy coupled with dispersion is the technique used for identification in accordance with EPA 600/M4-82-020, EPA 600/R-93/116, and NIOSH Method 9002.

^{**} The percentage of each component is visually estimated. The result of this analysis relate only to the material tested. The report shall not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. (>1% greater than one percent, <1% less than one percent) QC - Sample reanalyzed for QA/QC.

^{***} This report shall not be reproduced except in full, without the written approval of the laboratory. GLE Report # 21195

Okeechobee County Facilities; Arc Building

17000-17833

| Sample | Sample Type | Fiber Type |
|----------|--------------------------------------|----------------------------------|
| M-03B | Black Felt Paper Under Metal Roof | 100% Cellulose/paper |
| M-03C | Black Felt Paper Under Metal Roof | 100% Cellulose/paper |
| M-04A | Brown/White Ceramic Tile Grout | 100% Quartz, Calcite, Clay, Mica |
| M-04B | Brown/White Ceramic Tile Grout | 100% Quartz, Calcite, Clay, Mica |
| M-04C | Brown/White Ceramic Tile Grout | 100% Quartz, Calcite, Clay, Mica |
| M-05A | Gray Floor Leveling & White Backside | 100% Quartz, Calcite, Clay, Mica |
| M-05B | Gray Floor Leveling & White Backside | 100% Quartz, Calcite, Clay, Mica |
| M-05C | Gray Floor Leveling & White Backside | 100% Quartz, Calcite, Clay, Mica |
| M-06A | Concrete Building Slab | 100% Quartz, Calcite, Clay, Mica |
| M-06B-QC | Concrete Building Slab | 100% Quartz, Calcite, Clay, Mica |
| M-06C | Concrete Building Slab | 100% Quartz, Calcite, Clay, Mica |
| M-07A | Gray Window Glazing | 100% Quartz, Calcite, Clay, Mica |
| M-07B | Gray Window Glazing | 100% Quartz, Calcite, Clay, Mica |

Analyst / Approved Signatory:

Darryl Neldner

Analysis performed by GLE Associates, Inc. NVLAP Code 102003-0, CO AL-17485, TX 30-0337

Feedback regarding laboratory performance should be addressed to lab@gleassociates.com.

Report Date: 5/18/2017 Page 2 of 5

^{*} Polarized Light Microscopy coupled with dispersion is the technique used for identification in accordance with EPA 600/M4-82-020, EPA 600/R-93/116, and NIOSH Method 9002.

^{**} The percentage of each component is visually estimated. The result of this analysis relate only to the material tested. The report shall not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. (>1% greater than one percent, <1% less than one percent) QC - Sample reanalyzed for QA/QC.

^{***} This report shall not be reproduced except in full, without the written approval of the laboratory. GLE Report # 21195

Okeechobee County Facilities; Arc Building

17000-17833

| Sample | Sample Type | Fiber Type |
|------------|-------------------------|---|
| M-07C | Gray Window Glazing | 100% Quartz, Calcite, Clay, Mica |
| M-08A | White Caulk | 100% Polymer, Quartz, Calcite, Clay, Mica |
| M-08B | White Caulk | 100% Polymer, Quartz, Calcite, Clay, Mica |
| M-08C | White Caulk | 100% Polymer, Quartz, Calcite, Clay, Mica |
| MAS-01A | White HVAC Mastic | 100% Polymer, Quartz, Calcite, Clay, Mica |
| MAS-01B | White HVAC Mastic | 100% Polymer, Quartz, Calcite, Clay, Mica |
| MAS-01C-QC | White HVAC Mastic | 100% Polymer, Quartz, Calcite, Clay, Mica |
| MAS-02A | Gray HVAC Mastic | 100% Polymer, Quartz, Calcite, Clay, Mica |
| MAS-02B | Gray HVAC Mastic | 100% Polymer, Quartz, Calcite, Clay, Mica |
| MAS-02C | Gray HVAC Mastic | 100% Polymer, Quartz, Calcite, Clay, Mica |
| PCT-01A | White Popcorn Treatment | 100% Polymer, Quartz, Calcite, Clay, Mica |
| PCT-01B | White Popcorn Treatment | 100% Polymer, Quartz, Calcite, Clay, Mica |
| PCT-01C | White Popcorn Treatment | 100% Polymer, Quartz, Calcite, Clay, Mica |
| PL-01A | Interior Plaster Wall | 100% Quartz, Calcite, Clay, Mica |
| PL-01B | Interior Plaster Wall | 100% Quartz, Calcite, Clay, Mica |
| PL-01C | Interior Plaster Wall | 100% Quartz, Calcite, Clay, Mica |
| · | | |

Analyst / Approved Signatory:

Darryl Neldner

Analysis performed by GLE Associates, Inc. NVLAP Code 102003-0, CO AL-17485, TX 30-0337

Feedback regarding laboratory performance should be addressed to lab@gleassociates.com.

Report Date: 5/18/2017 Page 3 of 5

^{*} Polarized Light Microscopy coupled with dispersion is the technique used for identification in accordance with EPA 600/M4-82-020, EPA 600/R-93/116, and NIOSH Method 9002.

^{**} The percentage of each component is visually estimated. The result of this analysis relate only to the material tested. The report shall not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. (>1% greater than one percent, <1% less than one percent) QC - Sample reanalyzed for QA/QC.

^{***} This report shall not be reproduced except in full, without the written approval of the laboratory. GLE Report # 21195

Okeechobee County Facilities; Arc Building

17000-17833

| Sample Type | Fiber Type |
|--------------------------------------|--|
| Exterior Stucco | 100% Polymer, Quartz, Calcite, Clay, Mica |
| Exterior Stucco | 100% Polymer, Quartz, Calcite, Clay, Mica |
| Exterior Stucco | 100% Polymer, Quartz, Calcite, Clay, Mica |
| Black Rolled Roof | 100% Bitumen, Quartz, Calcite, Mica |
| Black Rolled Roof | 100% Bitumen, Quartz, Calcite, Mica |
| Black Rolled Roof | 100% Bitumen, Quartz, Calcite, Mica |
| Black Roof Flashing at Metal Roof | 100% Bitumen |
| Black Roof Flashing at Metal Roof | 100% Bitumen |
| Black Roof Flashing at Metal Roof | 100% Bitumen |
| Black Roof Flashing | 100% Bitumen |
| Black Roof Flashing | 100% Bitumen |
| Black Roof Flashing | 100% Bitumen |
| Yellow Texture Over Drywall | 100% Polymer, Quartz, Calcite, Clay, Mica |
| Yellow Texture Over Drywall | 100% Polymer, Quartz, Calcite, Clay, Mica |
| | Exterior Stucco Exterior Stucco Exterior Stucco Black Rolled Roof Black Rolled Roof Black Rolled Roof Black Roof Flashing at Metal Roof Black Roof Flashing Black Roof Flashing Black Roof Flashing Yellow Texture Over Drywall Yellow Texture Over |

Analyst / Approved Signatory:

Darryl Neldner

Analysis performed by GLE Associates, Inc. NVLAP Code 102003-0, CO AL-17485, TX 30-0337

Feedback regarding laboratory performance should be addressed to lab@gleassociates.com.

Report Date: 5/18/2017 Page 4 of 5

^{*} Polarized Light Microscopy coupled with dispersion is the technique used for identification in accordance with EPA 600/M4-82-020, EPA 600/R-93/116, and NIOSH Method 9002.

^{**} The percentage of each component is visually estimated. The result of this analysis relate only to the material tested. The report shall not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. (>1% greater than one percent, <1% less than one percent) QC - Sample reanalyzed for QA/QC.

^{***} This report shall not be reproduced except in full, without the written approval of the laboratory. GLE Report # 21195

Okeechobee County Facilities; Arc Building

17000-17833

| Sample | Sample Type | Fiber Type |
|--------|-------------------------------|--|
| S-01C | Yellow Texture Over 1 Drywall | 00% Polymer, Quartz, Calcite, Clay, Mica |

Analyst / Approved Signatory:

Darryl Neldner

Analysis performed by GLE Associates, Inc. NVLAP Code 102003-0, CO AL-17485, TX 30-0337

Feedback regarding laboratory performance should be addressed to lab@gleassociates.com.

Report Date: 5/18/2017 Page 5 of 5

^{*} Polarized Light Microscopy coupled with dispersion is the technique used for identification in accordance with EPA 600/M4-82-020, EPA 600/R-93/116, and NIOSH Method 9002.

^{**} The percentage of each component is visually estimated. The result of this analysis relate only to the material tested. The report shall not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. (>1% greater than one percent, <1% less than one percent) QC - Sample reanalyzed for QA/QC.

^{***} This report shall not be reproduced except in full, without the written approval of the laboratory. GLE Report # 21195

CHAIN OF CUSTODY/SAMPLE TRANSMITTAL FORM



GLE Associates, Inc. 1000 NW 65th Street, Suite 300-D Ft. Lauderdale, FL 33309

PHONE: (954) 968-6414 FAX: (954) 968-6090

CLIENT: Okeechobee

County Facilities

PROJECT #:

17000-17833

| _ | | | _ | _ | _ |
|---|---|----|---------------|----|---|
| R | O | JE | \mathbf{C}' | Г: | |

Pre-Demo ACM Survey Arc Building

| \mathbf{L}^{p} | VBC |)RA'I | ORY | SENT | TO: |
|------------------|------------|-------|-----|------|-----|
| | | | | | |

DATE: 5/17/17

| | | Dirizi | 5/1//1/ | |
|---|---|------------|-------------------------------------|--|
| | SAMPLE INI | FORMATION | N | |
| SAMPLE# | DESCRIPTION | SAMPLE# | DESCRIPTION | |
| CT-01 ABC | White 2x4 Ceiling Tile | MAS-01 AB | C White HVAC Mastic | |
| DW-01 ABC | Drywall with Joint Compound | MAS-02 AB | C Grey HVAC Mastic | |
| M-01 ABC | Grey Sink Under Coat | PCT-01 ABO | White Popcorn Treatment | |
| M-02 ABC | Yellow Carpet Glue | PL-01 ABC | Interior Plaster Wall | |
| M-03 ABC | Black Felt Paper Under Metal Roof | PL-02 ABC | Exterior Stucco | |
| M-04 ABC | Brown and White Ceramic Tile Grout | R-01 | Black Rolled Roof | |
| M-05 ABC | Grey Floor Leveling Floor with White Backside | RF-01 | Black Roof Flashing at Metal Roof | |
| M-06 ABC | Concrete Building Slab | RF-02 | Black Roof Flashing | |
| M-07 ABC | Grey Window Glazing | S-01 ABC | Yellow Texture Over Dry Wall | |
| M-08 ABC | White Caulking at Kitchen Counter | | | |
| IMPORTANT: TOTAL NUMBER OF SAMPLES SUBMITTED | | | 57 | |
| IMPORTANT: POSITIVE STOP ANALYSIS | | | | |
| IMPORTANT: E-MAIL RESULTS TO | | | Elongo Jsimmons | |
| NOTE: Turnaround time starts at receipt by lab and does not include weekend or holidays. | | | | |
| Select Turnaround Time 3 hour 6 Hour X 24 Hour 48 Hour 3 Day 4 Day | | | | |
| REPORT RESULTS TO THE ADDRESS ABOVE | | | | |
| CHAIN OF CUSTODY: GLE ASSOCIATES, DYC. | | | CHAIN OF CUSTODY: LABOR TORY | |
| THOUGHOLD BY: BOTCK TROWING | | | MPLES RECEIVED BY: | |
| DATE PACKAGED: 5/17/17 | | | TE: | |
| | | | TIME: CONDITION OF PACKAGED S MPLES | |
| TRANSMITTE | D BY: Elongo CHAIN OF CUSTODY: RETURNE | | | |
| RECEIVED BY: DATE: | | | | |
| INVENTORIED BY: | | | DATE: | |
| REPACKAGED AND SEALED BY: | | | DATE: | |
| PAGE: OF | | | | |

APPENDIX B Personnel and Laboratory Certifications



STATE OF FLORIDA DEPARTMENT OF BUSINESS AND PROFESSIONAL REGULATION


ASBESTOS LICENSING UNIT 1940 NORTH MONROE STREET TALLAHASSEE FL 32399-0783 (850) 487-1395

GLE ASSOCIATES INC 5405 CYPRESS CENTER DRIVE SUITE 110 TAMPA FL 33609

Congratulations! With this license you become one of the nearly one million Floridians licensed by the Department of Business and Professional Regulation. Our professionals and businesses range from architects to yacht brokers, from boxers to barbeque restaurants, and they keep Florida's economy strong.

Every day we work to improve the way we do business in order to serve you better. For information about our services, please log onto www.myfloridalicense.com. There you can find more information about our divisions and the regulations that impact you, subscribe to department newsletters and learn more about the Department's initiatives.

Our mission at the Department is: License Efficiently, Regulate Fairly. We constantly strive to serve you better so that you can serve your customers. Thank you for doing business in Florida, and congratulations on your new license!

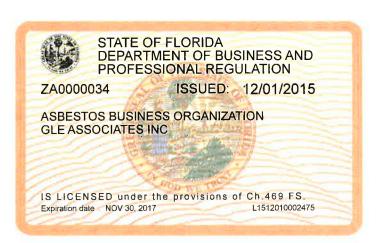

DETACH HERE

RICK SCOTT, GOVERNOR

KEN LAWSON, SECRETARY

STATE OF FLORIDA DEPARTMENT OF BUSINESS AND PROFESSIONAL REGULATION ASBESTOS LICENSING UNIT

LICENSE NUMBER

ZA0000034

The ASBESTOS BUSINESS ORGANIZATION Named below IS LICENSED Under the provisions of Chapter 469 FS. Expiration date: NOV 30, 2017

GLE ASSOCIATES INC 5405 CYPRESS CENTER DRIVE SUITE 110 TAMPA FL 33609







STATE OF FLORIDA DEPARTMENT OF BUSINESS AND PROFESSIONAL REGULATION

ASBESTOS LICENSING UNIT 2601 BLAIR STONE ROAD TALLAHASSEE FL 32399-0783 (850) 487-1395

GREENE, ROBERT BLAIR GLE ASSOCIATES INC 5405 CYPRESS CENTER DR SUITE 110 TAMPA FL 33609

Congratulations! With this license you become one of the nearly one million Floridians licensed by the Department of Business and Professional Regulation. Our professionals and businesses range from architects to yacht brokers, from boxers to barbeque restaurants, and they keep Florida's economy strong.

Every day we work to improve the way we do business in order to serve you better. For information about our services, please log onto www.myfloridalicense.com. There you can find more information about our divisions and the regulations that impact you, subscribe to department newsletters and learn more about the Department's initiatives.

Our mission at the Department is: License Efficiently, Regulate Fairly. We constantly strive to serve you better so that you can serve your customers. Thank you for doing business in Florida, and congratulations on your new license!



STATE OF FLORIDA
DEPARTMENT OF BUSINESS AND
PROFESSIONAL REGULATION

EA0000009

ISSUED: 11/15/2016

ASBESTOS CONSULTANT - ENGINEER GREENE, ROBERT BLAIR GLE ASSOCIATES INC

IS LICENSED under the provisions of Ch 469 FS. Expiration date: NOV 30, 2018 L1611150002176

DETACH HERE

RICK SCOTT, GOVERNOR

KEN LAWSON, SECRETARY

STATE OF FLORIDA DEPARTMENT OF BUSINESS AND PROFESSIONAL REGULATION ASBESTOS LICENSING UNIT

LICENSE NUMBER

EA0000009

The ASBESTOS CONSULTANT - ENGINEER Named below IS LICENSED Under the provisions of Chapter 469 FS.


Expiration date: NOV 30, 2018

GREENE, ROBERT BLAIR GLE ASSOCIATES INC 5405 CYPRESS CENTER DR SUITE 110 TAMPA FL 33609







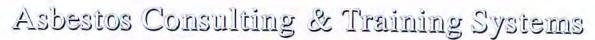

41306.4707CERT/BI

900 N.W. 5TH Avenue, Fort Lauderdale, Florida 33311 14 (954) 524-7208

This is to Certify that

Derek Rodriguez



19477 NE 10 AV, #203, Miami, FL 33179

Processed By:

www.seagulltraining.com 1-800-966-9933

has successfully completed an English

AHERA Building Inspector Course

16-Jan-17

TO

18-Jan-17

Meets state requirements of FL49-0001020/CN-0006272 and UT(6.0 core).

NDAAC Provider #451

Trainer(s): James F. Stump

TEST SCORE: 92 %

Training Address: 900 NW 5 AV, Fort Lauderdale, FL, 33311

Successful course completion based on exam score on: 01/18/17

This Certificate Expires:



18-Jan-18

James F. Stump, Course Sponson

Certificate Number: 1 7 Ø 8 3

Course Number: SE1703

United States Department of Commerce National Institute of Standards and Technology



Certificate of Accreditation to ISO/IEC 17025:2005

NVLAP LAB CODE: 102003-0

GLE Associates, Inc.

Tampa, FL

is accredited by the National Voluntary Laboratory Accreditation Program for specific services, listed on the Scope of Accreditation, for:

Asbestos Fiber Analysis

This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2005.

This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (refer to joint ISO-ILAC-IAF Communique dated January 2009).

2016-04-01 through 2017-03-31

Effective Dates



David I. alderna

For the National Voluntary Laboratory Accreditation Program